

Work Order ID 157961***157961***

Page 1

Monday, March 06, 2017 1:20:10 PM

Item ID: D412-664-443TRN

Accept

N900040100Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Crosstube Turning Detail

Start Date: 3/8/2017 Start Qty: 1.00

1

Cust Item ID:

Required Date: 3/14/2017 Req'd Qty: 1.00

1

Customer:

Reference: SCHEDULED

MAR 06 2017

Approvals: Process Plan:

DAS
21
9-89

Date:

Tooling:

Date:

Run Start ***NR1***

QC:

Date:

MAR 06 2017

SPC (Y/N):

Date:

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
Draw Nbr	Revision Nbr								
D412-664-443	REV A								

100

0.19

100

Mori Seiki

MORI SEIKI CNC LATHE LARGE

Memo

0.76

Mori Seiki CNC Lathe Large

1-Cut tube on chop saw, leave extra mat'l for facing and instal plugs 412-443 on both ends
2-Face both sides of tube to length.
3-turn tube on both sides using program #2000 as per folio FB216
4--turn tube on both sides using program #3000 as per folio FB216
FOLIO REV: AA
DWG REV: A
5-Blend transition lines using belt sander with 60 grit sand paper

1 $\emptyset$ DAS
23
9-89

17/3/17

110

QC2- Inspect parts off machine FAI/FAIB

0.00

110

QC

Memo

0.00

Quality Control

1 $\emptyset$ DAS
23
9-89

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval Completed By _____ Lead hand / Supervisor Approval Verification _____ QC / QA Coordinator Approval _____		
Description Work Order Deviation				Disposition					
2/10 CS 48									

Root Cause				FAULT CATEGORY			
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐		
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐		
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐		
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐		
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐		
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐		
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐		
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐		
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐		
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐		
Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____					
Misidentified ☐	Past Due ☐						

Work Order ID 157961***157961***

Page 2

Monday, March 06, 2017 1:20:10 PM

Item ID: D412-664-443TRN**Accept*****N900040100*****Setup Start *NS1*****Revision ID:****Stop *NS2*****Item Name:** Crosstube Turning Detail**Start Date:** 3/8/2017 **Start Qty:** 1.00***1*****Cust Item ID:****Required Date:** 3/14/2017 **Req'd Qty:** 1.00***1*****Customer:****Reference:** SCHEDULED**Approvals:****Process Plan:** _____**Date:** _____**Tooling:** _____**Date:** _____**Run Start *NR1*****QC:** _____**Date:** _____**SPC (Y/N):** _____**Date:** _____**Stop *NR2*****Sequence ID/
Work Center ID****Operation
Description****Set Up/
Run Hours****Tool ID****Tool #****Plan
Code****Accept
Qty****Reject
Qty****Reject
Number****Insp.
Stamp**

120

120

Mori Seiki

MORI SEIKI CNC LATHE LARGE

0.00

0.47

Memo

1-Turn tube on both sides using program #4000 and folio FB216

2-Turn tube on both sides using program #5000 and folio FB216

FOLIO REV: AADWG REV: 2

3-Blend transition lines using belt sander with 60 grit sand paper

4-SCRIBE PART NUMBER AS PER DWG

1ØDAS
23
9-89

17/3/19

130

130

QC

Quality Control

QC2- Inspect parts off machine FAI/FAIB

0.00

0.00

Memo

PERFORME ULTRA SONIC MESURMENTS

1ØDAS
23
9-89

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval Completed By _____ Lead hand / Supervisor Approval Verification _____ QC / QA Coordinator Approval _____		
Description Work Order Deviation				Disposition					

Root Cause				FAULT CATEGORY			
Environment ☐		No Re-verification ☐		Pressure/Forced ☐		Temperature/Cure ☐	
Design ☐		Operator ☐		Bending ☐		Set-up ☐	
Doc/Data ☐		Offset/Setup ☐		Centre Not Concentric ☐		BOM/Route ☐	
Equip/Tooling ☐		Supplier ☐		Cracks ☐		Broken/Damage/Defect ☐	
Handling/Pre ☐		Training ☐		Crimp/Kink/Ripple/Wave ☐		Inspection Incomplete/Unqualified ☐	
Material ☐		Use for Testing ☐		Cuffs ☐		Contamination ☐	
Internal Transport ☐		Poor Information ☐		Crushing ☐		Countersink ☐	
Tribal Knowledge ☐		Rushing ☐		Heat Treat ☐		Cut Too Short ☐	
LOA ☐		Product Improvement ☐		Wave/Twist in Tube ☐		Instructions Incomplete/Unclear ☐	
Substation ☐		Process Improvement ☐		Marks/Chatter ☐		Drill Holes ☐	
Past Expiry Date ☐		Manufacturing Process ☐		OTHER : _____			
Misidentified ☐		Past Due ☐					

Work Order ID 157961***157961***

Page 3

Monday, March 06, 2017 1:20:10 PM

Item ID: D412-664-443TRN

Accept

N900040100Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Crosstube Turning Detail

Start Date: 3/8/2017 Start Qty: 1.00

1

Cust Item ID:

Required Date: 3/14/2017 Req'd Qty: 1.00

1

Customer:

Reference: SCHEDULED

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start ***NR1***

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
140	QC8- Inspect parts - second check	0.00							
140									
QC	Memo	0.00							
Quality Control									P17-05-28
150		0.00							
150	Large Fab								
Crosstubes	Memo	0.12							
Crosstubes	Grind machining marks smooth longitude way.								
180	QC5- Inspect part completeness to step on W/O	0.00							
180									
QC	Memo	0.00							
Quality Control									

DAS
38
9-89
MAY 08 2017

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐																																																													
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval																																																										
Description Work Order Deviation				Disposition				Completed By																																																									
								Lead hand / Supervisor Approval Verification																																																									
								QC / QA Coordinator Approval																																																									
Root Cause		FAULT CATEGORY																																																															
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐	Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐	Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐	Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐	Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐	Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐	Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐	Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐	LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐	Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐	Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____			
Misidentified ☐	Past Due ☐																																																																

Work Order ID 157961***157961***

Page 4

Monday, March 06, 2017 1:20:10 PM

Item ID: D412-664-443TRN Accept ***N900040100*** Setup Start ***NS1***
Revision ID: Stop ***NS2***
Item Name: Crosstube Turning Detail
Start Date: 3/8/2017 Start Qty: 1.00 ***1*** Cust Item ID:
Required Date: 3/14/2017 Req'd Qty: 1.00 ***1*** Customer:
Reference: SCHEDULED

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
190 *100* Packaging Packaging	Identify as per dwg & Stock Location: <u>LG14</u> Packaging Memo LOCATION : LG003	0.00 0.00				<u>OPZ</u>	<u>17-05-08</u>		
200 *200* QC Quality Control	QC21- Final Inspection - Work Order Release Memo	0.00 0.02					<u>17/5/9</u>		

DAS
21
9-99

MAY 09 2017

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :				MRB (QSI042) Approval	
Description Work Order Deviation				Disposition				Completed By	
								Lead hand / Supervisor Approval Verification	
								QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY							
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____							
Misidentified ☐	Past Due ☐								

Picklist Print

Monday, March 06, 2017 1:20:15 PM

Page 1

Work Order ID: 157961

157961

Parent Item: D412-664-443TRN

D412-664-443TRN

Parent Item Name: Crosstube Turning Detail

Start Date: 3/8/2017

Required Date: 3/14/2017

Start Qty: 1.00

Required Qty: 1.00

Comments: IPP REV:A NEW ISSUE 13-09-26 JLM VERIFIED BY:DD

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
D6020-160		Manufactured	No			100	Each	44.0000	1	1			

D6020-160

Crosstube Material

**

Location	Loc Qty	Loc Code
HALL	9	
133623	9	
SHED	35	
133782	21	
141822	14	

17/3/15

DAS
23
9-89

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date : _____	Step #: _____	QTY Effective : _____		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY			
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐
OTHER : _____					

DART AEROSPACE LTD	Work Order: 157961
Description: Crosstube Assembly (412 High Aft SS)	Part Number: D412-664-443
Inspection Dwg: D412-664-443 Rev: A	Page 1 of 2

FIRST ARTICLE INSPECTION CHECKLIST

	Inspection Sheet Drawing Dimension	Tolerance	Actual Dimension	Accept	Reject	Method of Inspection	Comments
SIDE A	2.776	+0.005/-0.000	2.7795	✓		↑ Vernier ↓	
	2.776	+0.005/-0.000	2.780	✓			
	2.880	+0.005/-0.000	2.883	✓			
	2.990	+0.005/-0.000	2.991	✓			
	3.100	+0.005/-0.000	3.105	✓			
	3.250	+0.005/-0.000	3.253	✓			
	7.980	+/-0.060	7.980	✓		tape	
	0.063	+/-0.010	0.063	✓		R/B	
	0.500	+/-0.010	0.500	✓		↑	
	2.990	+0.005/-0.000	2.993	✓		Vernier	
SIDE B	2.776	+0.005/-0.000	2.778	✓		↑ Vernier ↓	
	2.776	+0.005/-0.000	2.779	✓			
	2.880	+0.005/-0.000	2.8845	✓			
	2.990	+0.005/-0.000	2.991	✓			
	3.100	+0.005/-0.000	3.105	✓			
	3.250	+0.005/-0.000	3.255	✓			
	7.98	+/-0.060	7.98	✓		tape	
	R0.06	+/-0.010	R0.06	✓		R/B	
	R0.50	+/-0.010	R0.50	✓		↑	
	Ø2.990	+0.005/-0.000	2.993	✓		Vernier	
	130.10	+/-0.060	130.10	✓		tape	

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE


QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date : _____		Step #: _____		QTY Effective : _____			MRB (QSI042) Approval		
Description Work Order Deviation				Disposition				Completed By	
								Lead hand / Supervisor Approval Verification	
								QC / QA Coordinator Approval	
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐							
OTHER : _____									

DART AEROSPACE LTD	Work Order:	157961
Description: Crosstube Assembly (412 High Aft SS)	Part Number:	D412-664-443
Inspection Dwg: D412-664-443 Rev: A		Page 2 of 2

WALL THICKNESS MEASUREMENT

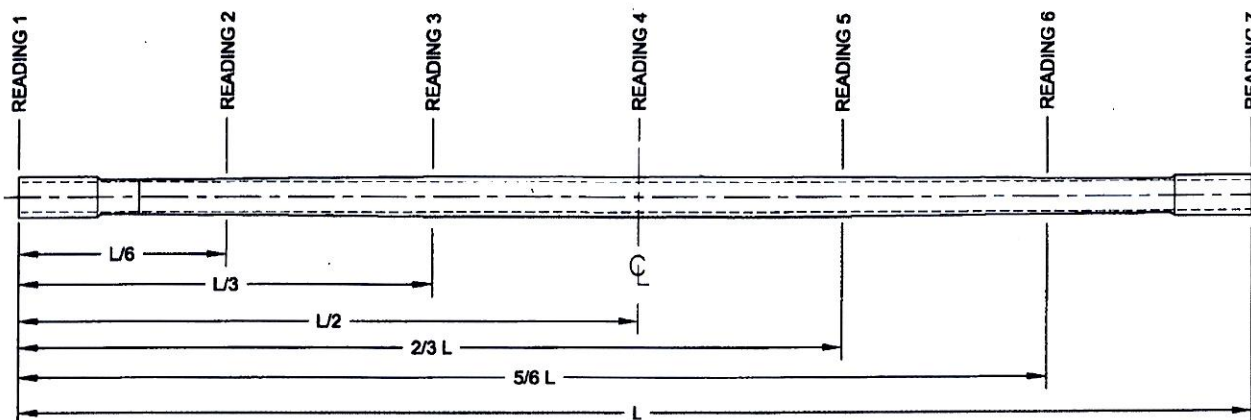

Location	WALL THICKNESS MEASUREMENT (IN)				Deviation Δw (max-min)	TOLERANCE
	w1	w2	w3	w4		
READING 1 L = 0"	297	300	300	295	0,005	0.073"
READING 2 L = 21.683	196	186	185	193	0,011	
READING 3 L = 43.356	320	312	301	305	0,019	
READING 4 L = 65.050	435	429	425	425	0,010	
READING 5 L = 86.733	308	306	300	303	0,008	
READING 6 L = 108.416	195	189	184	197	0,011	
READING 7 L = 130.100	295	297	300	298	0,005	

Calibration Result

Actual Block Thickness: 100.410

Sitiescan 250 Measured Thickness: 100.410

Measured by: DAS 23 9-89
Date: 17/3/23

Audited by: [Signature]
Date: 17-03-28

Preliminary Approval:
Date:

Rev	Date	Change	Revised by	Approved
A	14.06.24	New Issue (P/O D412-664-403)	KJ	[Signature]

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date : _____		Step #: _____		QTY Effective : _____			MRB (QS1042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval		
Description Work Order Deviation				Disposition					

Root Cause				FAULT CATEGORY			
Environment ☐	☐ No Re-verification	☐ Pressure/Forced	☐ Temperature/Cure	☐ Power Loss/Surge	☐ Positioned Wrong		
Design ☐	☐ Operator	☐ Bending	☐ Set-up	☐ Folio/Program	☐ Outside Dimensions		
Doc/Data ☐	☐ Offset/Setup	☐ Centre Not Concentric	☐ BOM/Route	☐ Grain	☐ Over/Under tolerance		
Equip/Tooling ☐	☐ Supplier	☐ Cracks	☐ Broken/Damage/Defect	☐ Weld	☐ Part Incorrect		
Handling/Pre ☐	☐ Training	☐ Crimp/Kink/Ripple/Wave	☐ Inspection Incomplete/Unqualified	☐ Wrong Stock Pulled	☐ Part Lost/Missing		
Material ☐	☐ Use for Testing	☐ Cuffs	☐ Contamination	☐ Out of Sequence	☐ Part Moved		
Internal Transport ☐	☐ Poor Information	☐ Crushing	☐ Countersink	☐ Off-set	☐ Drawing		
Tribal Knowledge ☐	☐ Rushing	☐ Heat Treat	☐ Cut Too Short	☐ Mislabeled	☐ Finish		
LOA ☐	☐ Product Improvement	☐ Wave/Twist in Tube	☐ Instructions Incomplete/Unclear	☐ Fit/Function	☐ Misread		
Substation ☐	☐ Process Improvement	☐ Marks/Chatter	☐ Drill Holes	☐ Misaligned/off center	☐ Turning Sequence		
Past Expiry Date ☐	☐ Manufacturing Process	OTHER : _____					
Misidentified ☐	☐ Past Due						

Item	Qty -443	Part Number	Description
1	X	D412-664-443	CROSSTUBE ASSEMBLY (412 HI AFT)
2	1	D6020-132	CROSSTUBE MATERIAL (132" MIN. LENGTH)
3	2	D3595-063-530	RUBBER CUSHION
4	1	D4909-1	SUPPORT
5	2	D4910-1	CHAFING SHIELD
7	4	MS21920-26	CLAMP
8	2	MS21920-28	CLAMP
9	A/R	SCOTCH-WELD DP460	EPOXY ADHESIVE, 3M SCOTCH-WELD
10	A/R	PROSEAL 890	SEALANT

GENERAL NOTES:

- MATERIAL: MANUFACTURED FROM D6020-132
FINISHED LENGTH = 130.10±0.060 (BEFORE BENDING/TRIMMING)
- FINISH: PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
MASK UNDERSIDE OF CROSSTUBE AS SHOWN (ZN C6-2, HATCHED AREA)
PAINT OUTSIDE PER DART QSI 005 4.2
AFTER PAINTING, REMOVE MASKING AND APPLY MATTE CLEAR COAT PER DART QSI 005 4.2
- TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
- UNITS: INCHES UNLESS OTHERWISE NOTED.
- BREAK SHARP EDGES: 0.005 TO 0.010 MAX.
- IDENTIFICATION: SCRIBE DART P/N "D412-664-443" AND B/N ON INSIDE OF CUFF PER DART QSI 044 6.4 (VIBRATING STYLUS)
- WEIGHT: 90.2 lb AFTER MACHINING
86.7 lb FINISHED WEIGHT
- PART IS SYMMETRIC ABOUT CENTERLINE.
- EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS SCRATCHES, NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE.

BENDING

- BEND PROGRESSIVELY WITH A MINIMUM OF 8 PASSES. MAXIMUM TUBE FLATTENING DUE TO BENDING IS 7% (BASED ON O.D.) IN LOWER HALF OF R35 BEND AND 6% (BASED ON O.D.) ON REMAINING TUBE.
- LIQUID PENETRANT INSPECT OUTSIDE SURFACE OF CROSSTUBE PER QSI 038. TO BE PERFORMED AFTER FINAL POST-BEND GRINDING. ANY ADDITIONAL GRINDING REQUIRES ANOTHER LPI INSPECTION.

ASSEMBLY

- INSTALL D4909-1 CENTER SUPPORT USING A 0.04" TO 0.07" THICK LAYER OF SCOTCH-WELD DP460 PER QSI 015.
- INSTALL MS21920-28 CLAMPS WITH D3595-063-530 RUBBER CUSHIONS TO SECURE THE D4909-1 SUPPORT ON TOP SIDE OF THE CROSSTUBE. ENSURE CLAMPS ARE ON TOP OF CROSSTUBE SUPPORT.
- IF NOT ALREADY PRESENT ON CHAFING SHIELD, APPLY A THIN COAT OF PROSEAL 890 ON INSIDE CONCAVE SURFACE OF D4910-1 CHAFING SHIELD AND LET CURE PER MANUFACTURER'S INSTRUCTIONS. INSTALL PROSEALED D4910-1 CHAFING SHIELD ONTO CROSSTUBE BY APPLYING A THIN COAT OF PROSEAL 890 ONTO CROSSTUBE. BE SURE TO ELIMINATE ANY AIR GAPS.
- TORQUE CLAMPS ON D4909-1 SUPPORT 80 TO 100 IN-LB. TORQUE CLAMPS ON D4910-1 CHAFING SHIELD 40 TO 50 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING. PRIOR TO PACKAGING, RE-CHECK TORQUE ON CLAMPS AFTER ADHESIVES HAVE CURED FOR 24 HOURS.

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 157961 *mc5*
1703 ok

UNDER REVIEW

4/15/15
OK
UP
4/15/15

UNDER REVIEW

4/17/15
OK
UP
4/17/15

RELEASED
2014-05-26
WPD

A	NEW ISSUE	CP	14.04.01
REV.	DESCRIPTION	BY	DATE
DESIGN	<i>DP</i>		
DRAWN	<i>DP</i>		
CHECKED	<i>DP</i>		
MFG. APPR.			
APPROVED			
DE APPR.			
DATE	14.04.01		

DART AEROSPACE LTD
HAWKESBURY, ONTARIO, CANADA

DRAWING NO. D412-664-443
TITLE CROSSTUBE ASSY (412 HI AFT)
SCALE NTS
REV. A SHEET 1 OF 4

COPYRIGHT © 2013 BY DART AEROSPACE LTD
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL, AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

DQA: _____ Date: _____


WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____


Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date : _____		Step #: _____		QTY Effective : _____			MRB (QSI042) Approval 		
Description Work Order Deviation				Disposition					
							Completed By		
							Lead hand / Supervisor Approval Verification		
							QC / QA Coordinator Approval		


Root Cause				FAULT CATEGORY			
Environment ☐		No Re-verification ☐		Pressure/Forced ☐		Temperature/Cure ☐	
Design ☐		Operator ☐		Bending ☐		Set-up ☐	
Doc/Data ☐		Offset/Setup ☐		Centre Not Concentric ☐		BOM/Route ☐	
Equip/Tooling ☐		Supplier ☐		Cracks ☐		Broken/Damage/Defect ☐	
Handling/Pre ☐		Training ☐		Crimp/Kink/Ripple/Wave ☐		Inspection Incomplete/Unqualified ☐	
Material ☐		Use for Testing ☐		Cuffs ☐		Contamination ☐	
Internal Transport ☐		Poor Information ☐		Crushing ☐		Countersink ☐	
Tribal Knowledge ☐		Rushing ☐		Heat Treat ☐		Cut Too Short ☐	
LOA ☐		Product Improvement ☐		Wave/Twist in Tube ☐		Instructions Incomplete/Unclear ☐	
Substation ☐		Process Improvement ☐		Marks/Chatter ☐		Drill Holes ☐	
Past Expiry Date ☐		Manufacturing Process ☐		OTHER : _____			
Misidentified ☐		Past Due ☐					

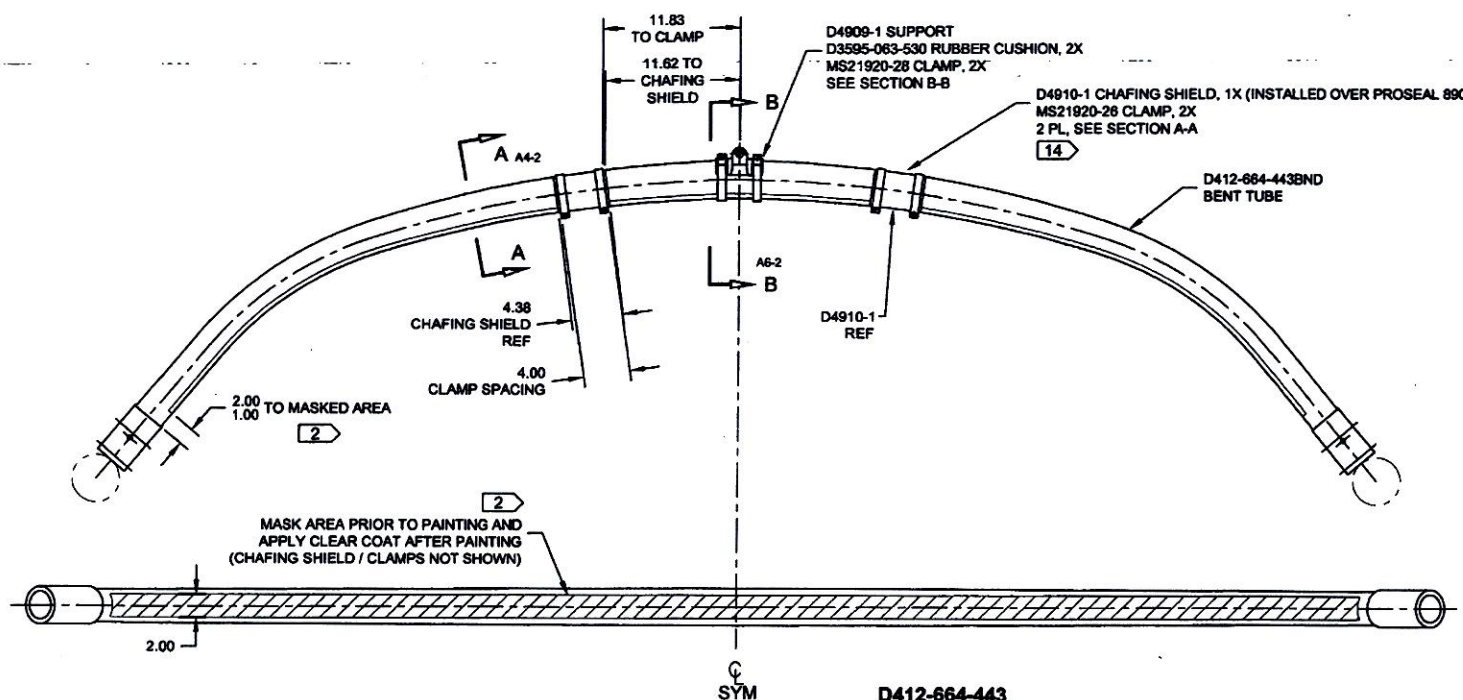

D412-664-443
ASSEMBLY DETAIL

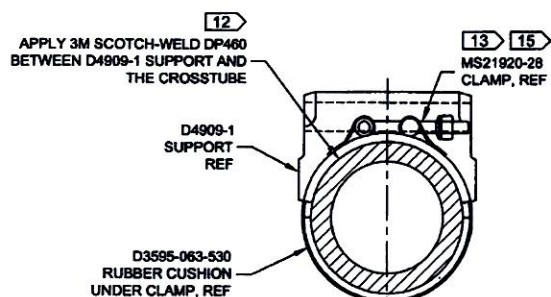

SECTION B-B D4-2
SCALE 4X

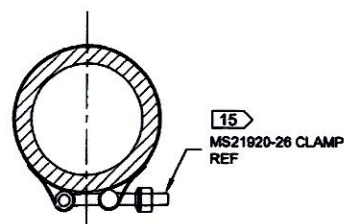

SECTION A-A C6-2
SCALE 4X

UNDER REVIEW
OK 9/14/14 11/16/14 1/17/15

RELEASED
R 2014-05-26
MP

UNDER REVIEW
AP 15/4/14 14/15

DESIGN	90	DART AEROSPACE LTD	
DRAWN	90	HAWKESBURY, ONTARIO, CANADA	
CHECKED	90	DRAWING NO.	REV. A
MFG. APPR.	90	D412-664-443	SHEET 2 OF 4
APPROVED	90	TITLE	SCALE
DE APPR.	90	CROSSTUBE ASSY (412 HI AFT)	NTS
DATE	14.04.01	COPYRIGHT © 2013 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE REPRODUCED OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

DQA: _____ Date: _____




WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____


Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval 		
Description Work Order Deviation				Disposition					
								Completed By	
								Lead hand / Supervisor Approval Verification	
								QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY							
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____							
Misidentified ☐	Past Due ☐								

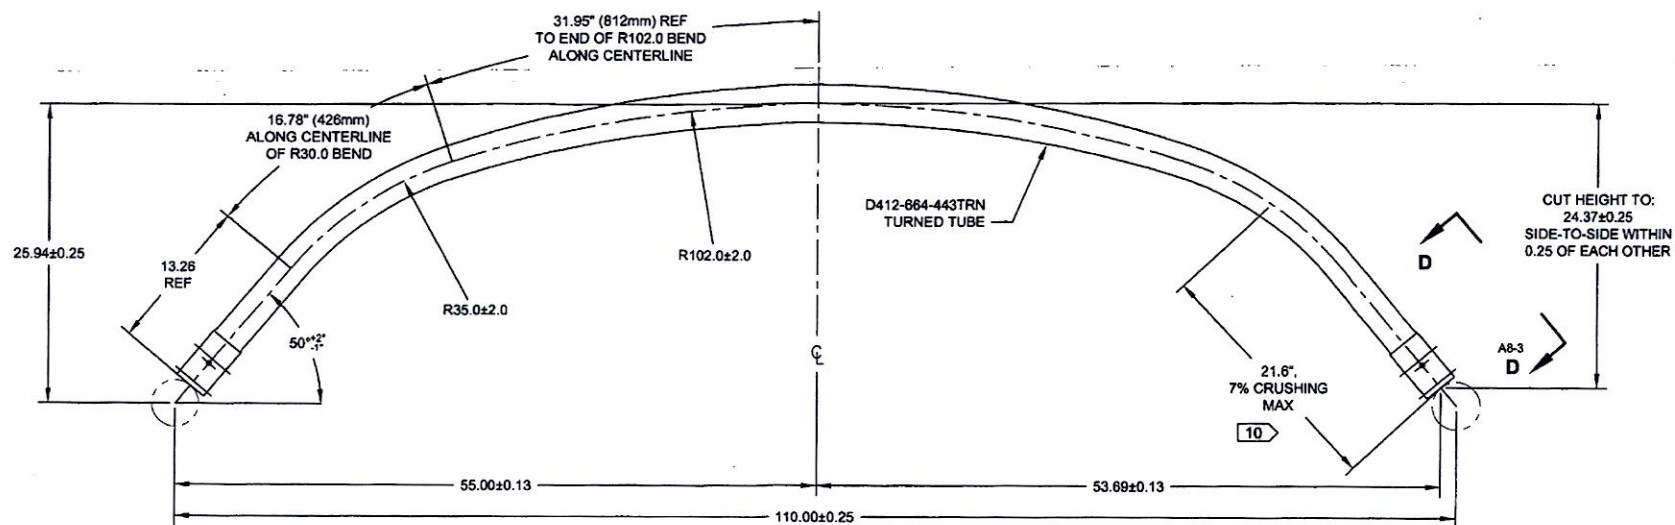

D412-664-443BND
BENDING DETAIL

10

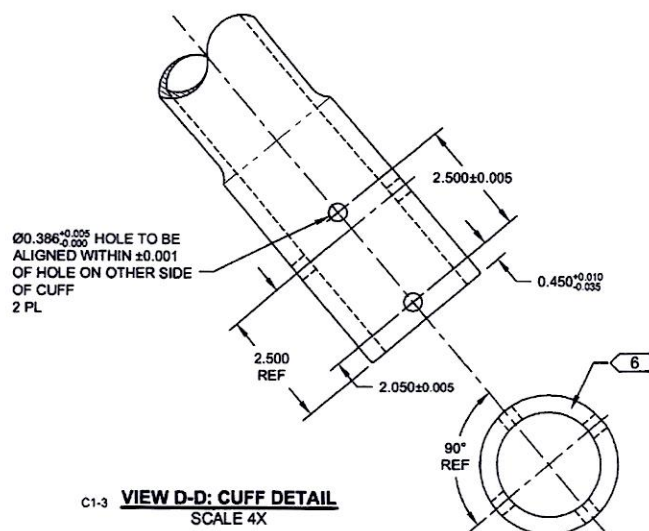

C1-3 **VIEW D-D: CUFF DETAIL**
SCALE 4X

OK
P. 1/14/14
UNDER REVIEW
11/17/16

UNDER REVIEW
15/1/24

RELEASED
2014-05-26

DESIGN	42	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	42		
CHECKED	DW	DRAWING NO.	REV. A
MFG. APPR.		D412-664-443	SHEET 3 OF 4
APPROVED		TITLE	SCALE
DE APPR.		CROSSTUBE ASSY (412 HI AFT)	NTS
DATE	14.04.01	COPYRIGHT © 2013 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSES OR COMMERCIALIZED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

DQA: _____ Date: _____




WORK ORDER NON-CONFORMANCE / UPDATE


QA Closed: _____ Date: _____

Work Order update only ☐


Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date : _____		Step #: _____		QTY Effective : _____			MRB (QSI042) Approval		
Description Work Order Deviation				Disposition				Completed By	
								Lead hand / Supervisor Approval Verification	
								QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY							
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____							
Misidentified ☐	Past Due ☐								

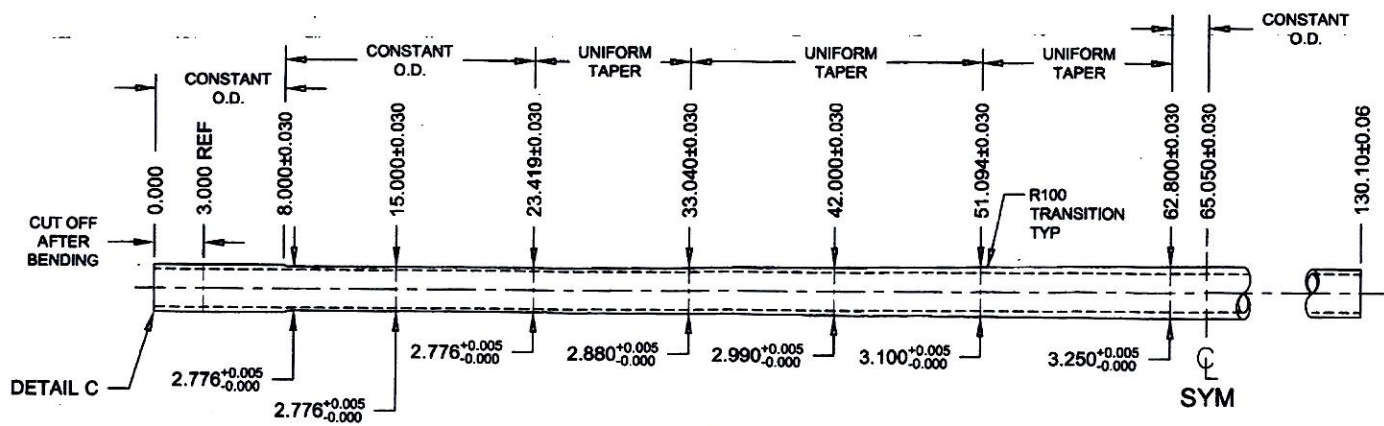

D412-684-443TRN
TURNING DETAIL

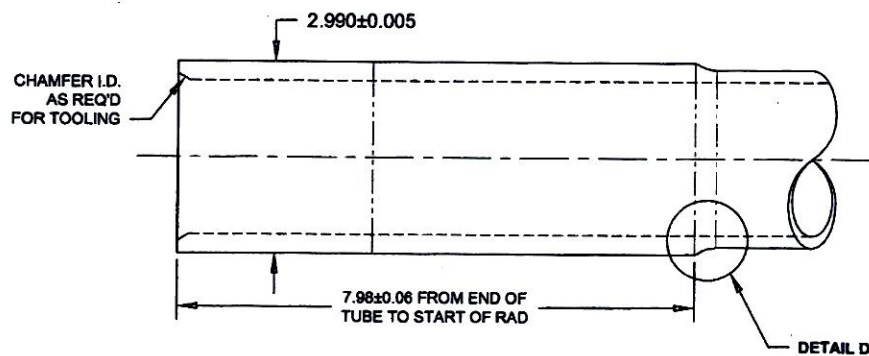

DETAIL C:
CUFF TRANSITION
SCALE 4X

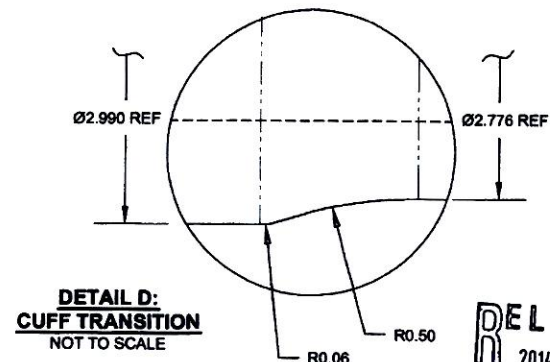

UNDER REVIEW
15/4/28

UNDER REVIEW
14/4/13

RELEASED
2014-05-26

DESIGN	<i>JP</i>	DART AEROSPACE LTD	
DRAWN	<i>JP</i>	HAWKESBURY, ONTARIO, CANADA	
CHECKED	<i>JP</i>	DRAWING NO.	REV. A
MFG. APPR.		D412-684-443	SHEET 4 OF 4
APPROVED	<i>JP</i>	TITLE	SCALE
DE APPR.	<i>JP</i>	CROSSTUBE ASSEMBLY (412 HI AFT)	NTS
DATE	14.04.01	COPYRIGHT © 2013 BY DART AEROSPACE LTD	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.			

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date : _____	Step #: _____	QTY Effective : _____		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition			Completed By
					Lead hand / Supervisor Approval Verification
					QC / QA Coordinator Approval
Root Cause		FAULT CATEGORY			
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐
OTHER : _____					